

Date:	11 <sup>th</sup> October 2004	<b>Jabiru Aircraft Pty Ltd</b> Document No: JSB003-1	Filename: Page:	JSB003-1 1 of 2
Jabiru J400 Door Bolts				

**SERVICE BULLETIN: JSB 003-1**

**Issue: 1**

**Date: 11<sup>th</sup> Oct 2004**

**Subject: Jabiru J400/J200 Door Bolts**

**1. Applicability:**

Jabiru J400, J200, J430, J230, J450 and J250 models


**2. Background:**

Some Builders of Jabiru J200/J400 series aircraft (All Jabiru Fuselages with 3 doors) have found that the bolts attaching the doors to the hinges are too short to positively engage the threads tapped in the aluminium hinges.

Date:	11 <sup>th</sup> October 2004	Jabiru Aircraft Pty Ltd Document No: JSB003-1	Filename: Page:	JSB003-1 2 of 2
Jabiru J400 Door Bolts				

### 3. Recommendations:

During the aircraft's next inspection, the hinges should be visually inspected. Refer to Figure 1 below.

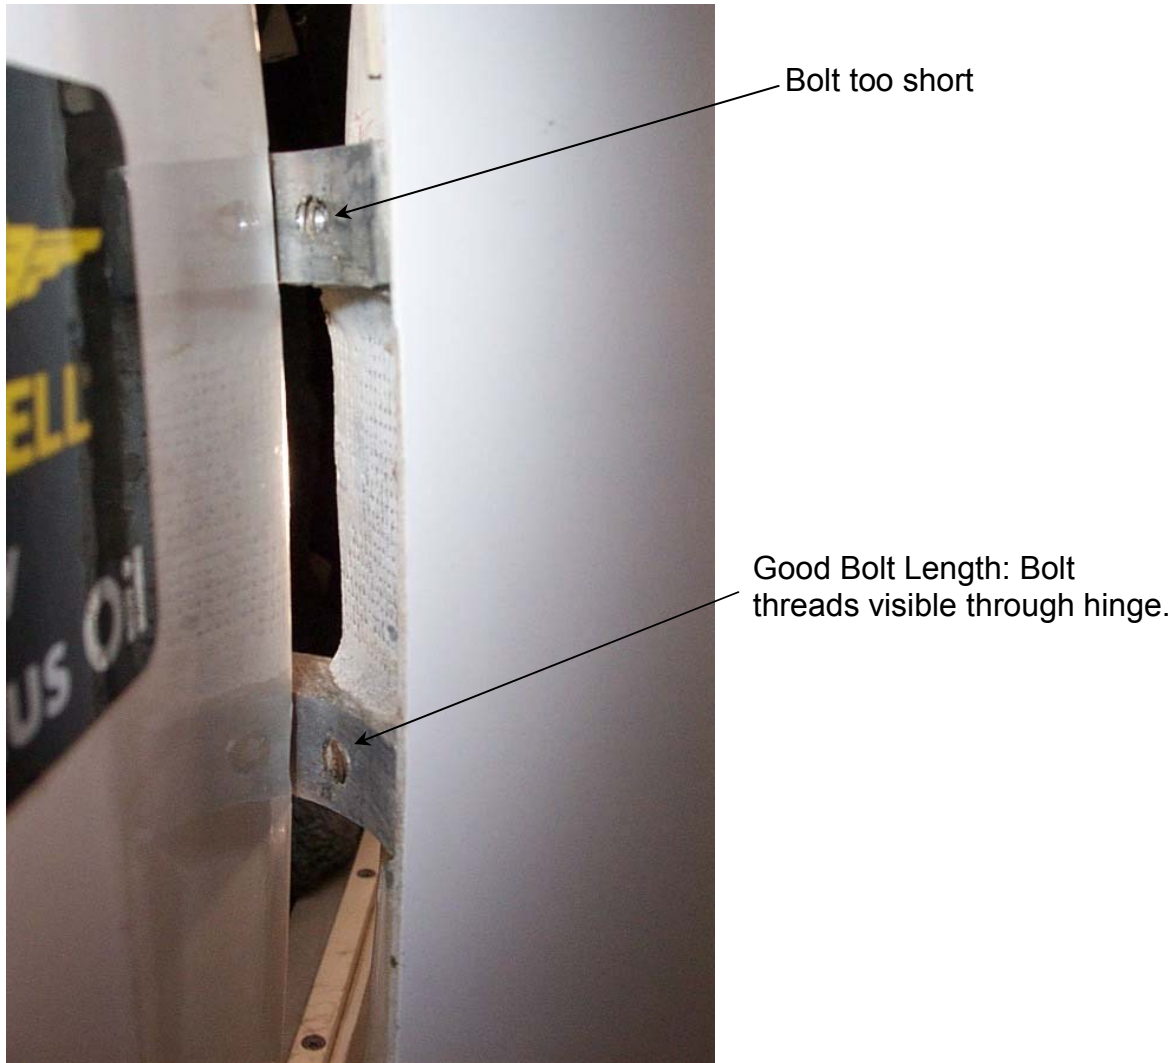

**Figure 1. Hinge Bolt Detail**

If one or more of the attachment bolts are short, as shown in the top bolt above, they are to be replaced with a longer item. The attachment bolts are 1/4" UNC Socket Head Cap screws.